Annual Audit Compliance Report Form

Environmental Protection Act 1986, Part V

Section A – Licence Details				
Licence number:	L8579/2011/2	Licence file number:	2012/006902-1	
Licence holder:	AngloGold Ashanti Australia Limited			
Trading as:	AngloGold Ashanti Australia Limited			
ACN:	008 737 424			
Registered address:	Level 10, 140 St Georges Tce, Perth WA 6000			
Reporting period:				

Section B – Statement of Compliance with Licence Conditions

Did you comply with all of your licence conditions during the reporting period? (Please tick the appropriate box)

□Yes – please complete:

- section C;
- · section D if required; and
- sign the declaration in Section F.

No – please complete:

- section C;
- · section D if required;
- section E; and
- · sign the declaration at Section F.

Section C – Statement of Actual Production

Provide the actual production quantity for this reporting period. Supporting documentation is to be attached.

Prescribed Premises Category	Actual Production Quantity
05 - Processing or beneficiation of metallic or non-metallic ore	3.89 Mtpa
06 - Mine dewatering	1,614,065 tonnes
52 - Electric power generation	48 MW
54 - Sewage facility	199.89 m³ per day
57 - Used tyre storage	<1,000
64 - Class II putrescible landfill site	2,560.33 tonnes

Section D – Statement of Actual Part 2 Waste Discharge Quantity				
Provide the actual Part 2 waste discharge quantity for this reporting period. Supporting documentation is to be attached.				
Prescribed Premises Category	Actual Part 2 Waste Discharge Quantity			
Tailings	3,893,694 tonnes			
Mine Dewatering	1,614,065 tonnes			

Section E – Details of Non-Compliance with Licence Condition

Please use a separate page for each condition with which the licence holder was non-compliant at a time during the reporting period.

Condition no:	4	Date(s) of non-complian	ce:			2024
Details of non-c	Details of non-compliance:					
The Infrastructu basis. Internal in period noted win an inspection ad Infrastructure re	re Departn spections nd-blown w ction to be ceived the ring accoul	on did not occur weekly nent undertakes inspection conducted quarterly by the raste was present during undertaken by the acco- inspection action, an a ntabilities for the landfill	ons and one Environe Environe each instantable distributions.	nme spec dep litte	ent Departme tion. This wa artment (Infr r pick-up wa	ent during the reporting as recorded in isims as astructure). Each time s conducted. AGAA is
What was the a	ctual (or su	spected) environmental	impact o	of the	e non-compli	ance?
NOTE – please non-compliance		os or diagrams to provid	e insight	into	the precise	location of where the
Waste Rock Lar landfill).	ndform and	iving environment due to lit is well within the Prer aste has occurred, just n	nises boı	unda	ary (Figure 1	Location of the
		e) of non-compliance:			•	
Staff turnover a	nd lack of o	clarity for accountability f	or the ac	tivit	y.	
Action taken to non-compliance		y adverse effects of non	-complia	nce	and prevent	recurrence of the
during 2024, a Department co	nd are inc intinues to	ng accountabilities for the reasing towards a wee o undertake inspection itter pick-ups are happ	ekly freq s and co	uen mn	cy. The En nunicate wit	vironment
Was this non-co	mpliance p	previously reported to D	NER?			
Yes. In the 202	23 AER an	d AACR.				
Reported to	DWER ver	bally	Date:	/	1	
Reported to	DWER in v	vriting	Date:	28	/2/2024	
DWER ticket AACR)	ID 01219	17 (2023 AER and				

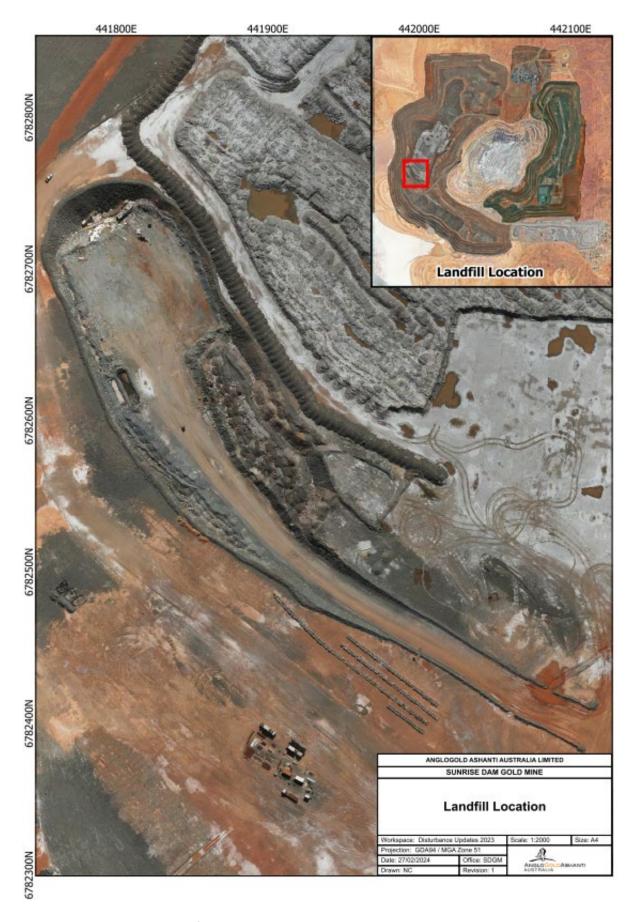


Figure 1 Landfill Location

Condition no:		Date(s) of non- compliance:	February 2024	
Details of non-comp	oliance:			
freeboard requirement DWER 14/2/2024 at	ng Department's routine Cants of the license were not and the following steps were not steps deposition immediately as Storage Facility (TSF). It detailed survey to confirm vide investigation to develop reduirements were reinstructuring during this time. As minor licence breech.	being met in one local undertaken: into that area of the Casual observation. Emediation plan to rein tated within a week within	tion This was reported to entral Tailings Deposition state 300 mm freeboard.	
	I (or suspected) environmen	•		
NOTE – please atta non-compliance too		ovide insight into the p	recise location of where the	
The freeboard requirements were reinstated within a week with no rainfall or tailings deposition occurring during this time. As such there were no environmental impacts as a result of the minor licence breech.				
Cause (or suspected cause) of non-compliance:				
Erosion				
Action taken to mitigate any adverse effects of non-compliance and prevent recurrence of the non-compliance:				
See above.				
Was this non-compl	iance previously reported to	DWER?		
Yes.				
Reported to DW	ER verbally	Date: / /		
Reported to DWI	ER in writing (email)	Date: 14/2/2024		
DWER reference ID 0119589	e number			

Date(s) of non-

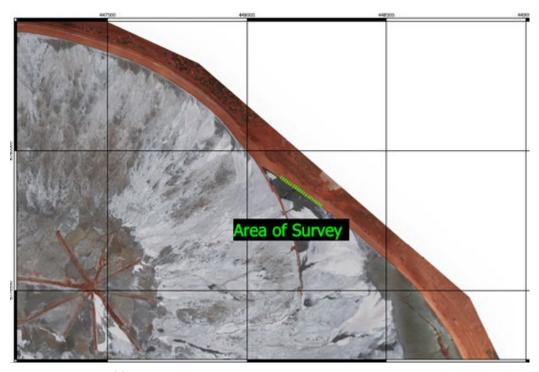


Figure 1: . Area of freeboard survey along the CTD

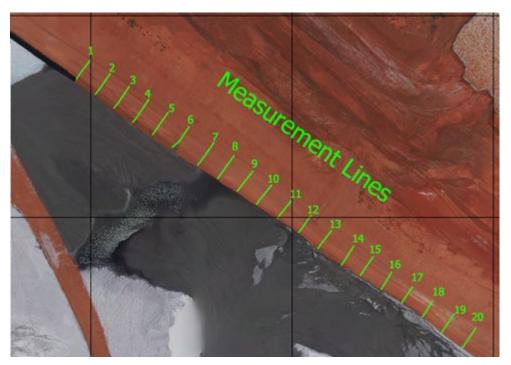


Figure 2: .Survey lines along the CTD.



Figure 3: .Embankment height side profile.

Section F – Declaration				
I/We declare that the information in this Annual Audit Compliance Report is true and correct and is not false or misleading in a material particular ¹ . I/We consent to the Annual Audit Compliance Report being published on the Department of Water and Environmental Regulation's (DWER) website.				
Signature:	Signature:			
Name: (printed)	Name: (printed)			
Position:	Position:			
Date:	Date:			
Seal (if signing under seal):				

¹ It is an offence under section 112 of the *Environmental Protection Act 1986* for a person to give information on this form that to their knowledge is false or misleading in a material particular.